DTIS FILE COPY



SECIJRITY CLASSIFICATION OF THIS PAGE					
REPOR	N PAGE		Form Approved OMB No. 0704-0188		
4- OCDORY SECTION OF ASSISTATION		1b. RESTRICTIVE None	MARKINGS		
	FECIL	3. DISTRIBUTION/AVAILABILITY OF REPORT			
AD-A219 166 ARU 5 1980 Unlimited					
AYA 2-89	ER(S)D.CS	5. MONITORING ORGANIZATION REPORT NUMBER(5)			
6a. NAME OF PERFORMING ORGANIZATION ARDEC	6b. OFFICE SYMBOL (If applicable) SMCAR-ESK	7a. NAME OF MONITORING ORGANIZATION			
6c. ADDRESS (City, State, and ZIP Code)	7b. ADDRESS (City, State, and ZIP Code)				
Rock Island, IL 61299-730					
8a. NAME OF FUNDING/SPONSORING ORGANIZATION	8b. OFFICE SYMBOL (If applicable)	9. PROCUREMENT INSTRUMENT IDENTIFICATION NUMBER			
8c. ADDRESS (City, State, and ZIP Code)		10. SOURCE OF FUNDING NUMBERS			
		PROGRAM ELEMENT NO.	PROJECT NO.	TASK NO.	WORK UNIT ACCESSION NO.
11. TITLE (Include Security Classification)					
Performance Oriented Packaging Testing of 4Cl POP Container of Wood Box					
12. PERSONAL AUTHOR(S) Mark Rehmstedt					
13a. TYPE OF REPORT 13b. TIME COVERED 14. DATE OF REPORT (Year, Month, Day) 15. PAGE COUNT					
Final FROM <u>89/11/8</u> TO <u>89/11/15</u> 89/11/15 3					3
16. SUPPLEMENTARY NOTATION					
17. COSATI CODES	Continue on reverse	e if necessary and	identify l	by block number)	
FIELD GROUP SUB-GROUP	Hazardous Materials / U.N. Recommendations on the Train				
	MIL-B-2427 PPP-B-621	of Dangerous Goods			
19. ABSTRACT (Continue on reverse if necessary and identify by block number)					
The U.S. Army Armament Research, Development and Engineering Center (ARDEC), was requested to verify that a MIL-B-2427 and PPP-B-621 wood box meets or exceeds the requirements of the United Nations, "Recommendation on the Transport of Dangerous Goods." The box was tested at the U.S. Army Defense Ammunition Center and School (USADACS) by performing a drop test and stacking test. There were five drops performed at a height of 48 inches; flat on top, flat on bottom, on a long side, a short side, and a corner. The stacking test was to simulate a load on the bottom box of a stacking height of 16 feet. The container met the requirements of a "4Cl" container of the Performance Oriented Packaging requirement.					
90 03 01 242					
20. DISTRIBUTION/AVAILABILITY OF ABSTRACT 21. ABSTRACT SECURITY CLASSIFICATION					
☐ UNCLASSIFIED/UNLIMITED ☐ SAME AS RPT. ☐ DTIC USERS ☐ Unclassified 22a. NAME OF RESPONSIBLE INDIVIDUAL 22b. TELEPHONE (Include Area Code) 22c. OFFICE SYMBO					EICE SYMBOL
David A. Piskorik, Chief (Packaging Office) AV					AR-ESK
DD Form 1473, JUN 86 Previous editions are obsolete. SECURITY CLASSIFICATION OF THIS PAGE					

Report Number:

DODPOPHM/AYA/TR89002

Title:

Performance Oriented Packaging Test of 4Cl Wood

Box

Container:

Box, Ammunition Packing: Wood, Nailed

UN Code:

4C1

Specification Number:

MIL-B-2427, Type 1, Class 1

Dimensions:

O.D. Inches $43.75 \times 14.25 \times 8.75$

Closure:

Metal Banding (3)

Gross Weight:

146 lbs.

Contents:

Inert 105mm ammunition

Test Performed:

Packaging Group II

1. Drop Tests - 1.2 meters

Bottom, Top, Long side, Short side, Corner (5 drops).

Contents of inner receptacles must be retained to pass.


2. Stacking Test

Compression top load equivalent to the weight of a 3 meter stack of like product must remain stable after 24 hrs. to pass.

Test Results:

- Drop Test Some minor separation of the nailed boards. Contents undamaged.
- 2. Stacking Test No damage after 24 hrs. of top load of 3,010 lbs.
- 3. Passed (UN criteria).



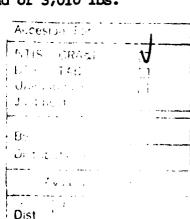

2-1

Container: Box, Wood, Nailed and Lock - Corners

UN Code: 4C1

Specification Number: PPP-B-621, Style 4 and 4 1/2

Dimensions: I.D. Inches 12.81 x 12.10 x 7.56

Closure: Nailed and Metal Strapped

Gross Weight: 98.7 lbs.

Contents: Lead Shot

Test Performed: Packaging Group II

Drop Tests - 1.2 meters
 Bottom, Top, Long side, Short side, Corner (5 drops).
 Contents of inner receptacles must be retained to pass.

2. Stacking Test Compression top load equivalent to the weight of a 3 meter stack of like product must remain stable after 24 hrs. to pass.

Test Results:

- 1. Drop Test Some minor splits occurred along nailing lines. Minor corner crushing observed on wood box. Contents undamaged.
- 2. Stacking Test No damage after 24 hrs. of top load of 1,450 lbs.
- 3. Passed (UN criteria).